QG series

QG65 analog H-series

QG65-KI-360H-AV-CM

Inclination sensor

1 axis vertical mounting

Programmable device
Output: 0,5 - 4,5 V

Measuring range programmable between 1° and 360°

Measuring range
Factory default: 360°



CE


	General specifications 11625, v20170825
Housing	Reinforced plastic injection molded (Faradex DS, black, EMI shielded by stainless steel fiber in PC)
Dimensions (indicative)	60x50x27 mm
Mounting	4x M5x25 mm zinc plated pozidrive screws included (optional: 2x Ø4mm positioning pins)
Ingress Protection (IEC 60529)	IP67
Relative humidity	0 - 100%
Weight	approx. 110 gram
Supply voltage	8 - 30V dc
Polarity protection	Yes
Current consumption	≤ 25 mA
Operating temperature	-40 .. +85 °C
Storage temperature	-40 .. +85 °C
Measuring range	Factory default: 360°
Centering function	Yes (2,5 V = 0°), range 360°
Frequency response (-3dB)	0 - 10 Hz
Accuracy (typ. and/or 2σ)	overall 0,07° typ.
Offset error	< ± 0,03° typ. (< ± 0,08° max.) after centering
Non linearity	< ± 0,06° typ. (< ± 0,15° max.)
Sensitivity error	not applicable
Resolution	0,01°
Temperature coefficient	± 0,005°/K typ.
Max mechanical shock	20.000g
Output	0,5 - 4,5 V
Output load	Rload ≥20kΩ, Cload ≤20 nF
Short circuit protection	Yes (max 10 s)
Output refresh rate	20 ms
Programming options	by optional QG65-configurator (measuring range, filtering)

QG series

QG65-KI-360H-AV-CM

Uout = 2,5 + 2*(α/180) [V]


Transfer characteristic

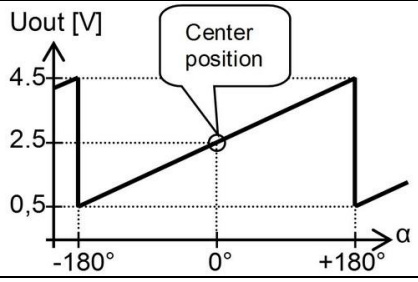

Rotation in vertical plane.

Lateral tilt sensitivity error:
< ± 0,03°/° lateral tilt (typ.)
Max. lateral tilt: 45°

Measurement orientation

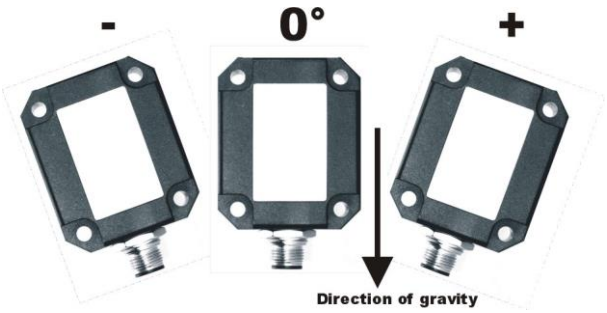


Connectivity (length ±10%)

Connection


M12 male 8p connector (Brass Nickel coated, contacts copper alloy)

Wire / pin coding

Pin 1:	Output for factory use only
Pin 2:	Supply voltage
Pin 3:	Programming interface RS232 Rx
Pin 4:	Programming interface RS232 Tx
Pin 5:	Gnd
Pin 6:	Centering input
Pin 7:	Output
Pin 8:	not connected

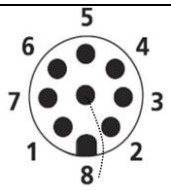

Mechanical dimensions (indicative only)

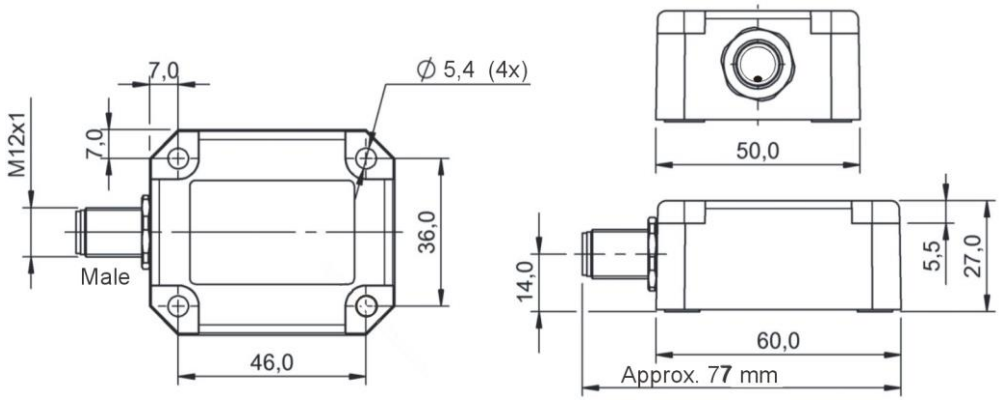

Center function

Centering can be done to eliminate mechanical offsets. To execute centering connect center input to ground (>0,5sec) within 1 min. after power up. After centering you have 1 min. left for another centering. Normally the center input should be left unconnected.

As this device is accelerometer-based the sensor is inherent sensitive for accelerations/vibrations. Application specific testing must be carried out to check whether this sensor will fulfil your requirements.